

## Case 323 : Narrative

Case Vehicle (A): 2001 Dodge	Vehicle (B): 1998 Ford
Type: Grand Caravan Sport, 4 x 2 minivan	Type: Windstar, 4 x 2 wagon
Driver: 69-year-old male	Driver: 48-year-old male
CDC: 01-FDEW-2	CDC: 10-LZAW-3, 03-RPAW-4

### SITUATION

[1](#) It was daylight, the weather was clear, and the intersection of the asphalt two-lane and three-lane roads was dry and free of defects. [2](#) [3](#) Case vehicle (A) was traveling east in the eastbound lane of the one-way, two-lane road. [4](#) [5](#) Vehicle (B) was traveling north in the northbound through lane of the two-way, three-lane road. [6](#) [7](#) As vehicle (B) entered the intersection, [8](#) [9](#) case vehicle (A) did not stop at the stop sign, and the front of case vehicle (A) struck the left side of vehicle (B). [10](#) After the impact, case vehicle (A) veered to the left, went over a curb, and came to rest facing northeast on the grassy area of the northeast corner of the intersection. [11](#) [12](#) [13](#) Vehicle (B) rotated counterclockwise, went over a curb, up a slight embankment, and struck a tree with its right side. Vehicle (B) came to rest facing north on the northeast corner of the intersection. Both vehicles were towed due to damage.

The police report indicated "B" injuries for the driver and right-front passenger of case vehicle (A), and "A" injuries for the driver of vehicle (B). The occupants of both vehicles were taken to a level-one trauma center by ambulance. The driver of case vehicle (A) was treated and released. The right-front passenger of case vehicle (A) was held for treatment for two days. The driver of vehicle (B) was held for treatment for one day.

## GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[14](#) Damage to case vehicle (A) was moderate. [15](#) Direct damage began at the left-front bumper corner and extended 165-cm to the right, across the entire frontal plane. [16](#) The maximum crush was 29 cm at the right-front lower radiator support.

Damage to vehicle (B) was extensive. [17](#) [18](#) [19](#) [20](#) Direct damage to the left side from impact by the case vehicle began at the lower-rear portion of the left door and extended 201 cm rearward to the left-rear bumper corner. The maximum crush was 33 cm to the forward portion of the left-rear wheel well. The left wheelbase was increased 10 cm. [21](#) Direct damage on the right side from impact with the tree was confined to the B-pillar area, [22](#) with a maximum crush of 51 cm at the B-pillar. The right wheelbase was reduced 13 cm.

Using the WinSMASH crash-reconstruction program, and [24](#) [25](#) [26](#) [27](#) crush profiles measured for case vehicle (A) and [28](#) [29](#) [30](#) vehicle (B), the following impact severities were calculated:

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	23 (15)	-22 (-14)	-8 (-5)
Vehicle (B)	delta V	28 (17)	-14 (-9)	24 (15)

## DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

### Exterior

[31](#) In the front, the bumper and the grille were knocked off, both headlight assemblies were shattered, and the radiator and the hood were crushed rearward and displaced to the left. The right-front fender was shifted 34-cm to the left, and the left-front fender was shifted 20-

cm to the left. [32](#) The hood latch was damaged and jammed, but had been pried open. [33](#) [34](#) Both hood hinges were deflected to the left, [35](#) the rear edge of the hood was elevated, and [36](#) the right-rear edge of the hood contacted and [37](#) cracked the lower right corner of the windshield.

On the left side, [38](#) the fender was crushed rearward and displaced to the left. [39](#) Both left doors remained closed and operational during the crash, and the left-side glazing remained intact. There was no significant change to the left wheelbase.

[40](#) The left-rear bumper corner was damaged by tow-yard personnel. [41](#) There was no other damage to the rear of the vehicle.

[42](#) On the right side, the front portion of the fender was crushed rearward and displaced to the left. [43](#) The right-front wheel rim was broken, but the tire was not flat. [44](#) Both right doors remained closed and operational during the crash. The right-side glazing remained intact. There was no other right-side damage and the right wheelbase was reduced 4 cm. [45](#) There was no under carriage damage.

## Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, [46](#) [47](#) [48](#) , and they both deployed in this frontal crash. [49](#) The steering wheel was rotated 180 degrees and locked in this position, and there was a blood smear on the right side of the tether stitching of the steering-wheel airbag. [50](#) There was make up or dirt transferred onto the passenger airbag fabric. [51](#) [52](#) There was no damage to the steering-wheel airbag module cover, but there was a black transfer mark just beneath the emblem. [53](#) There was no damage to the passenger airbag module. [54](#) [55](#) [56](#) The upper half of the steering-wheel rim was deflected slightly forward and the spokes were slightly deformed. [57](#) There was no rotation of the steering column.

[58](#) The plastic shoulder-belt guide on the left B-pillar was broken, and [59](#) the driver knee-bolster cover to the left of the steering column was scuffed. The [60](#) upper instrument panel

above the vertical console and the vertical console plastic trim were scuffed, [61](#) and the vertical console plastic trim was displaced. [62](#) The upper instrument panel covering around the passenger airbag cover was torn, and [63](#) [64](#) the plastic covering the driver seat base was cracked on the right side.

The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
Right front <a href="#">65</a>	kick panel	5	to left
	toe pan	2	to rear

[66](#) [67](#) [68](#) [69](#) [70](#) [71](#) [72](#) [73](#) [74](#) [75](#) [76](#) [77](#) There was no other interior damage.

## OCCUPANT KINEMATICS AND INJURIES

[78](#) The 5-ft, 9-in, 343-lb, 69-year-old male driver was wearing the three-point belt, and [79](#) the frontal-impact airbag deployed. [80](#) There were webbing imprints on the plastic D-ring, indicating belt use at the time of the crash. [78](#) The driver seat was positioned in a rearward track position with the seatback relatively upright, and [81](#) the adjustable shoulder-belt guide was in the full-down position.

On impact, the driver moved forward and to the right relative to the vehicle interior, into the belt restraint and airbag. He sustained fractures to the posterior aspects of the right fifth, sixth, and seventh ribs, and a contusion to the right side of the chest, probably due to loading by the shoulder belt. He sustained a contusion to the right knee, possibly due to contact with the vertical console, [61](#) as indicated by the displaced plastic cover. He sustained a contusion to the left knee and a non-displaced transverse fracture to the proximal fibular metaphysis, probably due to contact with the knee bolster below the steering column, [82](#) as indicated by scuff marks on the plastic cover.



[83](#) The 5-ft, 6-in, 270-lb, 69-year-old female right-front passenger was **not** wearing the three-point belt, and [50](#) the frontal-impact airbag deployed. [84](#) There were no webbing imprints on the plastic D-ring to indicate belt use at the time of the crash, and [85](#) there were very few scratches on the metal latch plate to indicate general belt use. The right-front seat was positioned in a rearward track position with the seatback relatively upright. On impact, the right-front passenger moved forward and to the right relative to the vehicle interior, into, and to the right of, the airbag. She sustained a coronally oriented fracture to C2, involving the inferior and right aspects of the vertebral body, and extending into the right vertebral foramina. This fracture is possibly due to neck compression and extension caused by head contact with the headliner and sunvisor, as indicated by hair [86](#) [87](#) on the headliner behind the sunvisor, or possibly from head contact with the upper portion of the A-pillar, [88](#) as indicated by a small scuff mark. She sustained a fracture to a lower right rib with a small adjacent pleural effusion, probably from contact with the right-front door interior, [72](#) although there were no witness marks on the door.

The following tables and attached drawings [89](#) [90](#) summarize the injuries for the two occupants of case vehicle (A).

Occupant: Driver	Age: 69 years	Gender: Male		
Restraints: 3-point belt worn; frontal-impact airbag deployed	Stature: 175 cm (5 ft, 9 in)	Mass: 156 kg (343 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Fractures, posterior aspects of right fifth, sixth, and seventh ribs	2	—	Shoulder belt	—
Contusion, right side of chest	1	—	Shoulder belt	—
Non displaced transverse fracture, proximal left fibular metaphysis	2	—	Knee bolster	—
Contusion, left knee	1	—	Knee bolster	—
Contusion, right knee	1	—	—	Vertical console
Maximum A.I.S. Level	2	—	—	—
Injury Severity Score	9	—	—	—

Occupant: Right front	Age: 69 years	Gender: Female		
Restraints: 3-point belt <i><b>not</b></i> worn; frontal-impact airbag deployed	Stature: 168 cm (5 ft, 6 in)	Mass: 122 kg (270 lb)		
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Coronally oriented fracture to C2, involving the inferior and right aspects of the vertebral body, and extending into the right vertebral foramina	2	—	—	Headliner/sunvisor, upper portion of A-pillar
Fracture, lower right rib with small adjacent right pleural effusion	1	—	Right-front door interior	—
Maximum A.I.S. Level	2	—	—	—
Injury Severity Score	5	—	—	—

CASE NO.: 100-001

CASE VEHICLE: 2001 Dodge

TYPE: Grand Cherokee Sport, station

OCCUPANT: Driver 48-year-old male

STATURE: 178 cm (5'6, 4-in) Weight: 100 kg(220 lb)

RESTRAINTS: 3-point belt worn, airbag deployed

SEVERITY: Head - 2      Torso - 6



CASE NO.: 883-87

CASE HISTORY: 2001 Dodge

TYPE: Grand Canyon Sped. accident

EXCULPATORY: Right impact, 40-year-old female

STATURE: 168cm (5' 6, 6 in) MASS: 532 kg (290 lb)

RIGHT HANDS: 3-point seat belt worn, airbag-deployed

SEVERITY: MASS - 2      AGE - 5





**Abstract**

**Abstract**

1000

1. **Introduction**  
 2. **Background**  
 3. **Methodology**  
 4. **Results**  
 5. **Conclusion**  
 6. **References**  
 7. **Appendix**  
 8. **Index**  
 9. **Table of Contents**  
 10. **Figure 1**  
 11. **Figure 2**  
 12. **Figure 3**  
 13. **Figure 4**  
 14. **Figure 5**  
 15. **Figure 6**  
 16. **Figure 7**  
 17. **Figure 8**  
 18. **Figure 9**  
 19. **Figure 10**  
 20. **Figure 11**  
 21. **Figure 12**  
 22. **Figure 13**  
 23. **Figure 14**  
 24. **Figure 15**  
 25. **Figure 16**  
 26. **Figure 17**  
 27. **Figure 18**  
 28. **Figure 19**  
 29. **Figure 20**  
 30. **Figure 21**  
 31. **Figure 22**  
 32. **Figure 23**  
 33. **Figure 24**  
 34. **Figure 25**  
 35. **Figure 26**  
 36. **Figure 27**  
 37. **Figure 28**  
 38. **Figure 29**  
 39. **Figure 30**  
 40. **Figure 31**  
 41. **Figure 32**  
 42. **Figure 33**  
 43. **Figure 34**  
 44. **Figure 35**  
 45. **Figure 36**  
 46. **Figure 37**  
 47. **Figure 38**  
 48. **Figure 39**  
 49. **Figure 40**  
 50. **Figure 41**  
 51. **Figure 42**  
 52. **Figure 43**  
 53. **Figure 44**  
 54. **Figure 45**  
 55. **Figure 46**  
 56. **Figure 47**  
 57. **Figure 48**  
 58. **Figure 49**  
 59. **Figure 50**  
 60. **Figure 51**  
 61. **Figure 52**  
 62. **Figure 53**  
 63. **Figure 54**  
 64. **Figure 55**  
 65. **Figure 56**  
 66. **Figure 57**  
 67. **Figure 58**  
 68. **Figure 59**  
 69. **Figure 60**  
 70. **Figure 61**  
 71. **Figure 62**  
 72. **Figure 63**  
 73. **Figure 64**  
 74. **Figure 65**  
 75. **Figure 66**  
 76. **Figure 67**  
 77. **Figure 68**  
 78. **Figure 69**  
 79. **Figure 70**  
 80. **Figure 71**  
 81. **Figure 72**  
 82. **Figure 73**  
 83. **Figure 74**  
 84. **Figure 75**  
 85. **Figure 76**  
 86. **Figure 77**  
 87. **Figure 78**  
 88. **Figure 79**  
 89. **Figure 80**  
 90. **Figure 81**  
 91. **Figure 82**  
 92. **Figure 83**  
 93. **Figure 84**  
 94. **Figure 85**  
 95. **Figure 86**  
 96. **Figure 87**  
 97. **Figure 88**  
 98. **Figure 89**  
 99. **Figure 90**  
 100. **Figure 91**  
 101. **Figure 92**  
 102. **Figure 93**  
 103. **Figure 94**  
 104. **Figure 95**  
 105. **Figure 96**  
 106. **Figure 97**  
 107. **Figure 98**  
 108. **Figure 99**  
 109. **Figure 100**  
 110. **Figure 101**  
 111. **Figure 102**  
 112. **Figure 103**  
 113. **Figure 104**  
 114. **Figure 105**  
 115. **Figure 106**  
 116. **Figure 107**  
 117. **Figure 108**  
 118. **Figure 109**  
 119. **Figure 110**  
 120. **Figure 111**  
 121. **Figure 112**  
 122. **Figure 113**  
 123. **Figure 114**  
 124. **Figure 115**  
 125. **Figure 116**  
 126. **Figure 117**  
 127. **Figure 118**  
 128. **Figure 119**  
 129. **Figure 120**  
 130. **Figure 121**  
 131. **Figure 122**  
 132. **Figure 123**  
 133. **Figure 124**  
 134. **Figure 125**  
 135. **Figure 126**  
 136. **Figure 127**  
 137. **Figure 128**  
 138. **Figure 129**  
 139. **Figure 130**  
 140. **Figure 131**  
 141. **Figure 132**  
 142. **Figure 133**  
 143. **Figure 134**  
 144. **Figure 135**  
 145. **Figure 136**  
 146. **Figure 137**  
 147. **Figure 138**  
 148. **Figure 139**  
 149. **Figure 140**  
 150. **Figure 141**  
 151. **Figure 142**  
 152. **Figure 143**  
 153. **Figure 144**  
 154. **Figure 145**  
 155. **Figure 146**  
 156. **Figure 147**  
 157. **Figure 148**  
 158. **Figure 149**  
 159. **Figure 150**  
 160. **Figure 151**  
 161. **Figure 152**  
 162. **Figure 153**  
 163. **Figure 154**  
 164. **Figure 155**  
 165. **Figure 156**  
 166. **Figure 157**  
 167. **Figure 158**  
 168. **Figure 159**  
 169. **Figure 160**  
 170. **Figure 161**  
 171. **Figure 162**  
 172. **Figure 163**  
 173. **Figure 164**  
 174. **Figure 165**  
 175. **Figure 166**  
 176. **Figure 167**  
 177. **Figure 168**  
 178. **Figure 169**  
 179. **Figure 170**  
 180. **Figure 171**  
 181. **Figure 172**  
 182. **Figure 173**  
 183. **Figure 174**  
 184. **Figure 175**  
 185. **Figure 176**  
 186. **Figure 177**  
 187. **Figure 178**  
 188. **Figure 179**  
 189. **Figure 180**  
 190. **Figure 181**  
 191. **Figure 182**  
 192. **Figure 183**  
 193. **Figure 184**  
 194. **Figure 185**  
 195. **Figure 186**  
 196. **Figure 187**  
 197. **Figure 188**  
 198. **Figure 189**  
 199. **Figure 190**  
 200. **Figure 191**  
 201. **Figure 192**  
 202. **Figure 193**  
 203. **Figure 194**  
 204. **Figure 195**  
 205. **Figure 196**  
 206. **Figure 197**  
 207. **Figure 198**  
 208. **Figure 199**  
 209. **Figure 200**  
 210. **Figure 201**  
 211. **Figure 202**  
 212. **Figure 203**  
 213. **Figure 204**  
 214. **Figure 205**  
 215. **Figure 206**  
 216. **Figure 207**  
 217. **Figure 208**

U.S. Census Bureau, 2000

[illegible]

# Vehicle Report

## General

## Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	<a href="#">more</a>
V207 — Limited Access Highway	0	No	<a href="#">more</a>
V208 — Road Total Lanes	2	2 lanes	<a href="#">more</a>
V209 — Intersecting Road Total Lanes	3	3 lanes	<a href="#">more</a>
V210 — Road Surface Type	1	Asphalt	<a href="#">more</a>
V211 — Road Defects	0	No	<a href="#">more</a>
V212 — Construction Zone	0	No	<a href="#">more</a>
V213 — Road Alignment Vertical Plane	1	Level	<a href="#">more</a>
V214 — Road Alignment Horizontal Plane	1	Straight	<a href="#">more</a>
V215 — Surface Covering	10	Dry	<a href="#">more</a>
V216 — Visibility Limitation	0	None	<a href="#">more</a>
V217 — Visibility Obstruction	0	None	<a href="#">more</a>
V218 — Speed Limit	4	71-79 km/h .. 45 mph	<a href="#">more</a>
V219 — Precipitation Type	0	None	<a href="#">more</a>
V220 — Precipitation Rate	8	Not applicable	<a href="#">more</a>
V221 — Temperature	9	Unknown	<a href="#">more</a>
V222 — Crosswind	9	Unknown	<a href="#">more</a>
V223 — Light Conditions	1	Daylight	<a href="#">more</a>
V224 — Mechanical Malfunction Mention	0	No	<a href="#">more</a>
V225 — Case Vehicle and Object	0	No	<a href="#">more</a>
V226 — Case Vehicle Rollover	0	No	<a href="#">more</a>

V227 — Case Vehicle Ran Off Roadway	0	No	<a href="#">more</a>
V228 — Moving Case Vehicle/Contacted Moving Vehicle	1	Yes	<a href="#">more</a>
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	<a href="#">more</a>
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	<a href="#">more</a>
V231 — Total Vehicles Hit By Case Vehicle	1	1 vehicle	<a href="#">more</a>
V232 — Any Fire in Crash	0	No	<a href="#">more</a>
V233 — Max Police Severity-PAR	3	A - Incapacitating Injury	<a href="#">more</a>
V234 — Driver Alcohol Involvement	0	Had not been drinking	<a href="#">more</a>
V235 — Driver Alcohol BAC	80	Not tested	<a href="#">more</a>
V236 — Driver Impairment Mention	0	No	<a href="#">more</a>
V237 — Driven/Towed From Scene	2	Towed Due to Damage	<a href="#">more</a>

## Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN	2FMZA5142WBD	—	—
V302 — Other Vehicle Manufacturer/Body Code	22111	—	—
V303 — Other Vehicle Manufacturer	221	Ford/Canada	<a href="#">more</a>
V304 — Other Vehicle Body Code	11	Passenger van; panel or cargo van	<a href="#">more</a>
V305 — Other Vehicle Make/Model	3133	Windstar	<a href="#">more</a>
V306 — Other Vehicle Model Year	1998	—	—
V307 — Other Vehicle Mass	001706 kg	—	—
V308 — Other Vehicle Number	0	No separate report	<a href="#">more</a>
V309 — Other Vehicle Number of Occupants	01	—	—
V310 — Other Vehicle Traveling Speed	999	Unknown	<a href="#">more</a>
V311 — Highest Police Injury Severity	3	A - Incapacitating Injury	<a href="#">more</a>
V312 — Other Vehicle Type	11	Small van (e.g. Econoline)	<a href="#">more</a>
V313 — Other Vehicle Wheelbase (cm)	307 cm	—	—
V314 — Average Track Width	162 cm	—	—
V315 — Overall Length	511 cm	—	—
V316 — Overall Width (OAW)	189 cm	—	—
V317 — Front Overhang (FOH)	102 cm	—	—
V318 — Rear Overhang (ROH)	102 cm	—	—
V319 — Undeformed End Width (UEW)	160 cm	—	—
V320 — Engine Displacement	3.8 l	—	—
V321 — Engine: Number of Cylinders	06	—	—
V322 — Direct Damage Length (DDL)	999	Unknown	<a href="#">more</a>
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	<a href="#">more</a>
V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	<a href="#">more</a>



## Case Vehicle

### General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	2B4GP44RX1R2	—	—
V402 — Manufacturer/Body Code	23211	—	—
V403 — Vehicle Manufacturer	232	Dodge	<a href="#">more</a>
V404 — Vehicle Body Code	11	—	—
V405 — Make/Model Code	3220	Caravan, Minivan	<a href="#">more</a>
V406 — Model Year	2001	—	—
V407 — Vehicle Mass	001855 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	02	—	—
V410 — Traveling Speed	999	Unknown	<a href="#">more</a>
V411 — Body Type	24	Van (small)	<a href="#">more</a>
V412 — Stolen Vehicle	8	Not currently collected	<a href="#">more</a>
V413 — Body Structure	2	Unitized	<a href="#">more</a>
V414 — Transmission Type	1	Automatic	<a href="#">more</a>
V415 — Transmission Lever Location	3	Column	<a href="#">more</a>
V416 — Steering	1	Power	<a href="#">more</a>
V417 — Brakes	1	Power	<a href="#">more</a>
V418 — Brake Type	3	Disc - all wheels	<a href="#">more</a>
V419 — Brake Anti-lock Device	2	Four-wheel	<a href="#">more</a>
V420 — Air Conditioning in Vehicle	8	Not currently collected	<a href="#">more</a>
V421 — Drive Type	2	Front wheel	<a href="#">more</a>
V422 — Dual Rear Wheels	0	No	<a href="#">more</a>
V423 — Original Restraint System Type	3	Airbag	<a href="#">more</a>

V424 — Equipped With Roll Bar	0	No	<a href="#">more</a>
V425 — Roof Type	1	Solid	<a href="#">more</a>
V426 — Wheelbase	303 cm	—	—
V427 — Anti-lacerative Glass	0	None	<a href="#">more</a>
V428 — Average Track Width	161 cm	—	—
V429 — Overall Length	510 cm	—	—
V430 — Overall Width (OAW)	200 cm	—	—
V431 — Front Overhang	095 cm	—	—
V432 — Rear Overhang	111 cm	—	—
V433 — Undeformed End Width (UEW)	165 cm	—	—
V434 — Engine Displacement	3.3 l	—	—
V435 — Engine: Number of Cylinders	06	—	—
V436 — Direct Damage Length (DDL)	165 cm	—	—
V437 — Front End Overlap % (FEO)	98	98% or more	<a href="#">more</a>
V438 — Vehicle Overlap % (VOL)	98	98% or more	<a href="#">more</a>

## Case Vehicle

### Damage

### Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	029 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	<a href="#">more</a>
V507 — Are Events In Chronological Order	1	Yes	<a href="#">more</a>
V508 — Event 1 Impact Location	1	On Roadway	<a href="#">more</a>
V509 — Event 1 Impact Configuration	13	FRONT of case veh - SIDE of contacted Vehicle	<a href="#">more</a>
V510 — Event 1 Object/Vehicle Contacted	11	Small van (e.g. Econoline)	<a href="#">more</a>
V511 — Event 2 Impact Location	8	No 2nd event	<a href="#">more</a>
V512 — Event 2 Impact Configuration	88	No 2nd event	<a href="#">more</a>
V513 — Event 2 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V514 — Event 3 Impact Location	8	No 3rd event	<a href="#">more</a>
V515 — Event 3 Impact Configuration	88	No 3rd event	<a href="#">more</a>
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V517 — Event 4 Impact Location	8	No 4th event	<a href="#">more</a>
V518 — Event 4 Impact Configuration	88	No 4th event	<a href="#">more</a>
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V520 — Event 5 Impact Location	8	No 5th event	<a href="#">more</a>
V521 — Event 5 Impact Configuration	88	No 5th event	<a href="#">more</a>
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V523 — Event 6 Impact Location	8	No 6th event	<a href="#">more</a>

V524 — Event 6 Impact Configuration	88	No 6th event	<a href="#">more</a>
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V526 — Event 7 Impact On Road	8	No 7th event	<a href="#">more</a>
V527 — Event 7 Impact Configuration	88	No 7th event	<a href="#">more</a>
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	<a href="#">more</a>
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	<a href="#">more</a>
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	<a href="#">more</a>
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V532 — Primary CDC Case Vehicle -crush	029	—	—
V533 — Primary CDC Case Vehicle -clock #1	01	1 o'clock	<a href="#">more</a>
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	<a href="#">more</a>
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	<a href="#">more</a>
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	<a href="#">more</a>
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V538 — Primary CDC Case Vehicle Extent #1	02	Extent 2	<a href="#">more</a>
V539 — Primary CDC Case Vehicle -CDC #1	01FDE W2	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	999	Unknown	<a href="#">more</a>
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	<a href="#">more</a>
V549 — Primary CDC Contacted Vehicle -crush	033	—	—
V550 — Primary CDC Contacted Vehicle -clock #1	10	10 o'clock	<a href="#">more</a>
V551 — Primary CDC Contacted Vehicle letter 1 #1	12	L - Left Side	<a href="#">more</a>

V552 — Primary CDC Contacted Vehicle letter 2 #1	26	Z - Side or end (B + P or R + C)	<a href="#">more</a>
V553 — Primary CDC Contacted Vehicle letter 3 #1	01	A - All or Top of vehicle to bottom of vehicle exclusive of	<a href="#">more</a>
V554 — Primary CDC Contacted Vehicle letter 4 #1	23	W - Wide impact area	<a href="#">more</a>
V555 — Primary CDC Contacted Vehicle Extent #1	03	Extent 3	<a href="#">more</a>
V556 — Primary CDC Contacted Vehicle -CDC #1	10LZAW 3	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	8	Not applicable	<a href="#">more</a>
V565 — Secondary CDC Case Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V566 — Secondary CDC Case Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	<a href="#">more</a>
V567 — Secondary CDC Case Vehicle -crush	998	Not Applicable	<a href="#">more</a>
V568 — Secondary CDC Case Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V574 — Secondary CDC Case Vehicle -CDC #1	9800000	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>

V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	<a href="#">more</a>
V583 — Secondary CDC Contacted Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	<a href="#">more</a>
V584 — Secondary CDC Contacted Vehicle -crush	998	Not Applicable	<a href="#">more</a>
V585 — Secondary CDC Contacted Vehicle -clock #1	98	Not Applicable	<a href="#">more</a>
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	<a href="#">more</a>
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	<a href="#">more</a>
V591 — Secondary CDC Contacted Vehicle -CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	<a href="#">more</a>
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	<a href="#">more</a>
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

## Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	023 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-022 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	-008 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	0090 kJ	—	—
V606 — Primary Impact Case Vehicle -reconstruction	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	028 kph	—	—
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	-014 kph	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	0024 kph	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	0036 kJ	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	<a href="#">more</a>
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—
V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V619 — Secondary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	<a href="#">more</a>
V620 — Secondary Contacted Vehicle Reconstructed	8888	—	—

Longitudinal Delta-V			
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	029 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-028 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	-010 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	0090 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	<a href="#">more</a>
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	<a href="#">more</a>
V630 — Primary Contacted Vehicle Reconstruction Total EBS	048 kph	—	—
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	-024 kph	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	0042 kph	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	0036 kJ	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	<a href="#">more</a>
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction Note	88	—	—
V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	<a href="#">more</a>
V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	<a href="#">more</a>



V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	<a href="#">more</a>
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	165 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	029 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	126 cm	—	—
V650 — Case Vehicle Impact 1 C1	021 cm	—	—
V651 — Case Vehicle Impact 1 C2	022 cm	—	—
V652 — Case Vehicle Impact 1 C3	029 cm	—	—
V653 — Case Vehicle Impact 1 C4	029 cm	—	—
V654 — Case Vehicle Impact 1 C5	026 cm	—	—
V655 — Case Vehicle Impact 1 C6	012 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0000 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	1	—	—
V658 — Case Vehicle Impact 2 Plane	4	Above sill	<a href="#">more</a>
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	201 cm	—	—
V660 — Case Vehicle Impact 2 Max Crush	033 cm	—	—
V661 — Case Vehicle Impact 2 Field-L	207 cm	—	—
V662 — Case Vehicle Impact 2 C1	000 cm	No Crush	<a href="#">more</a>
V663 — Case Vehicle Impact 2 C2	023 cm	—	—
V664 — Case Vehicle Impact 2 C3	028 cm	—	—
V665 — Case Vehicle Impact 2 C4	033 cm	—	—
V666 — Case Vehicle Impact 2 C5	028 cm	—	—
V667 — Case Vehicle Impact 2 C6	007 cm	—	—
V668 — Case Vehicle Impact 2 +/- D	-050 cm	—	—

V669 — Other Vehicle Reconstructed Impact Number	2	—	—
V670 — Other Vehicle Impact 1 Plane	8	Not applicable	<a href="#">more</a>
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	998	Not applicable	<a href="#">more</a>
V672 — Other Vehicle Impact 1 Max Crush	998	Not applicable	<a href="#">more</a>
V673 — Other Vehicle Impact 1 Field-L	998	Not applicable	<a href="#">more</a>
V674 — Other Vehicle Impact 1 C1	998	Not applicable	<a href="#">more</a>
V675 — Other Vehicle Impact 1 C2	998	Not applicable	<a href="#">more</a>
V676 — Other Vehicle Impact 1 C3	998	Not applicable	<a href="#">more</a>
V677 — Other Vehicle Impact 1 C4	998	Not applicable	<a href="#">more</a>
V678 — Other Vehicle Impact 1 C5	998	Not applicable	<a href="#">more</a>
V679 — Other Vehicle Impact 1 C6	998	Not applicable	<a href="#">more</a>
V680 — Other Vehicle Impact 1 +/- D	9998	—	—
V681 — Other Vehicle Reconstructed Impact Number	2	—	—
V682 — Other Vehicle Impact 2 Plane	8	Not applicable	<a href="#">more</a>
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	998	Not applicable	<a href="#">more</a>
V684 — Other Vehicle Impact 2 Max Crush	998	Not applicable	<a href="#">more</a>
V685 — Other Vehicle Impact 2 Field-L	998	Not applicable	<a href="#">more</a>
V686 — Other Vehicle Impact 2 C1	998	Not applicable	<a href="#">more</a>
V687 — Other Vehicle Impact 2 C2	998	Not applicable	<a href="#">more</a>
V688 — Other Vehicle Impact 2 C3	998	Not applicable	<a href="#">more</a>
V689 — Other Vehicle Impact 2 C4	998	Not applicable	<a href="#">more</a>
V690 — Other Vehicle Impact 2 C5	998	Not applicable	<a href="#">more</a>
V691 — Other Vehicle Impact 2 C6	998	Not applicable	<a href="#">more</a>
V692 — Other Vehicle Impact 2 +/- D	9998	—	—

## Case Vehicle

### Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	0	No	<a href="#">more</a>
V702 — Right Front Wheel Damaged	1	Yes	<a href="#">more</a>
V703 — Right Rear Wheel Damaged	0	No	<a href="#">more</a>
V704 — Left Rear Wheel Damaged	0	No	<a href="#">more</a>
V705 — Left Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V706 — Right Front Tire Tread Type	4	All Weather	<a href="#">more</a>
V707 — Right Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V708 — Left Rear Tire Tread Type	4	All Weather	<a href="#">more</a>
V709 — Left Front Carcass Construction	3	Radial	<a href="#">more</a>
V710 — Right Front Carcass Construction	3	Radial	<a href="#">more</a>
V711 — Right Rear Carcass Construction	3	Radial	<a href="#">more</a>
V712 — Left Rear Carcass Construction	3	Radial	<a href="#">more</a>
V717 — Left Front Tire Size	21565R16	—	—
V718 — Right Front Tire Size	21565R16	—	—
V719 — Right Rear Tire Size	21565R16	—	—
V720 — Left Rear Tire Size	21565R16	—	—

## Case Vehicle

### Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	<a href="#">more</a>
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	<a href="#">more</a>
V803 — Main Filler Cap Location	313	Left of frame laterally - above vertically	<a href="#">more</a>
V804 — Main Tank Material	3	Plastic	<a href="#">more</a>
V805 — Aux Tank Type	8	Not applicable (not equipped)	<a href="#">more</a>
V806 — Aux Tank Location	888	Not applicable (not equipped)	<a href="#">more</a>
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	<a href="#">more</a>
V808 — Aux Tank Material	8	Not applicable	<a href="#">more</a>
V901 — Fuel Leakage From Crash	0	No	<a href="#">more</a>
V1001 — Fire In Or On Case Vehicle	0	No	<a href="#">more</a>

## Case Vehicle

### Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	<a href="#">more</a>
V1102 — Hood Latch Damaged	1	Yes	<a href="#">more</a>
V1103 — Hood Latch Jammed	1	Yes	<a href="#">more</a>
V1104 — Left Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1105 — Left Hood Hinge Separated	0	No	<a href="#">more</a>
V1106 — Right Hood Hinge Damaged	1	Yes	<a href="#">more</a>
V1107 — Right Hood Hinge Separated	0	No	<a href="#">more</a>
V1108 — Hood Remained On Vehicle	1	Yes	<a href="#">more</a>
V1109 — Rear Hood Edge Elevated	1	Yes	<a href="#">more</a>
V1110 — Edge Contacted Windshield	1	Yes	<a href="#">more</a>
V1111 — Edge Penetrated Windshield	0	No	<a href="#">more</a>
V1112 — Hood Latch Location	1	Front of Vehicle	<a href="#">more</a>
V1113 — Eng/Transmissn Mount Separation	0	No	<a href="#">more</a>
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	<a href="#">more</a>
V1115 — Steerng Column Coupling Damaged	9	Unknown	<a href="#">more</a>
V1116 — Steerng Column Coupling Separated	9	Unknown	<a href="#">more</a>
V1117 — Eng Comp Telescopng Unit	88	Not collected	<a href="#">more</a>
V1118 — Comp Orig/Telescopd Diff	888	Not collected	<a href="#">more</a>
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1120 — Upper Left A-pillar Separation	0	No	<a href="#">more</a>
V1121 — Lower Left A-pillar Separation	0	No	<a href="#">more</a>
V1122 — Upper Left B-pillar Separation	0	No	<a href="#">more</a>
V1123 — Lower Left B-pillar Separation	0	No	<a href="#">more</a>
V1124 — Upper Left C-pillar Separation	0	No	<a href="#">more</a>

V1125 — Lower Left C-pillar Separation	0	No	<a href="#">more</a>
V1126 — Upper Left D-pillar Separation	0	No	<a href="#">more</a>
V1127 — Lower Left D-pillar Separation	0	No	<a href="#">more</a>
V1128 — Left Front Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1129 — Left Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1130 — Left Front Door Jammed Closed	0	No	<a href="#">more</a>
V1131 — Left Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1132 — Rear Door Type	2	One-way tailgate	<a href="#">more</a>
V1133 — Rear Door Opening Cause	0	Door did not open	<a href="#">more</a>
V1134 — Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1135 — Luggage Partition Damagd	8	Not applicable	<a href="#">more</a>
V1136 — Spare Tire Status	8	Not collected	<a href="#">more</a>
V1137 — Trailer Hitch Type	0	No hitch	<a href="#">more</a>
V1138 — Trailer Type	0	No trailer	<a href="#">more</a>
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	<a href="#">more</a>
V1140 — Upper Right A-pillar Separation	0	No	<a href="#">more</a>
V1141 — Lower Right A-pillar Separation	0	No	<a href="#">more</a>
V1142 — Upper Right B-pillar Separation	0	No	<a href="#">more</a>
V1143 — Lower Right B-pillar Separation	0	No	<a href="#">more</a>
V1144 — Upper Right C-pillar Separation	0	No	<a href="#">more</a>
V1145 — Lower Right C-pillar Separation	0	No	<a href="#">more</a>
V1146 — Upper Right D-pillar Separation	0	No	<a href="#">more</a>
V1147 — Lower Right D-pillar Separation	0	No	<a href="#">more</a>
V1148 — Right Front Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1149 — Right Rear Door Opening Cause	00	Door did not open	<a href="#">more</a>
V1150 — Right Front Door Jammed Closed	0	No	<a href="#">more</a>
V1151 — Right Rear Door Jammed Closed	0	No	<a href="#">more</a>
V1152 — Van Rear Door Type	4	Track (sliding)-right & left side	<a href="#">more</a>
V1153 — Windshield Cracked		Yes	<a href="#">more</a>

V1154 — Windshield Broken	0	No	<a href="#">more</a>
V1155 — Windshield Cracked or Broken by Occupant	0	No	<a href="#">more</a>
V1156 — Bond Separation Extent	0	None	<a href="#">more</a>
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Steering

#### Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	1	Deformed slightly	<a href="#">more</a>
V1202 — Number of Steering Wheel Spokes	4	4 spokes	<a href="#">more</a>
V1203 — Steering Wheel Spoke Damage	1	Deformed slightly	<a href="#">more</a>
V1204 — Column Tilt Feature	2	Up	<a href="#">more</a>
V1205 — Column Swing-away Feature	0	Not equipped	<a href="#">more</a>
V1206 — Column Telescoping Feature	0	Not equipped	<a href="#">more</a>
V1207 — Wheel Energy Absorb Device	8	Not collected	<a href="#">more</a>
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	<a href="#">more</a>
V1209 — Column Energy Absorb Device	88	Not collected	<a href="#">more</a>
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	<a href="#">more</a>
V1211 — Shear Capsule Separation	888	Not collected	<a href="#">more</a>
V1212 — Column Vertical Rotation	0	No apparent rotation	<a href="#">more</a>
V1213 — Column Lateral Rotation	0	No apparent rotation	<a href="#">more</a>
V1214 — Steering Wheel Hub Damage	1	Occupant contact	<a href="#">more</a>



## Case Vehicle

### Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	<a href="#">more</a>
V1302 — Was Intrusion Catastrophic	0	No	<a href="#">more</a>
V1303 — Intrusion Number 01	01	Intrusion #1	<a href="#">more</a>
V1304 — Intrusion 01 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1305 — Intrusion 01 Intruding Object	29	Side footwell panel (kickpanel)	<a href="#">more</a>
V1306 — Intrusion 01 Assoc Event Number	1	Event #1	<a href="#">more</a>
V1307 — Intrusion 01 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1308 — Intrusion 01 Max Intrusion Y-axis	05 cm	—	—
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1310 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1311 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1312 — Intrusion 01 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1313 — Intrusion 01 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1314 — Intrusion Number 02	02	Intrusion #2	<a href="#">more</a>
V1315 — Intrusion 02 Occupant Space Number	13	First row, Right seat	<a href="#">more</a>
V1316 — Intrusion 02 Intruding Object	03	Toe pan	<a href="#">more</a>
V1317 — Intrusion 02 Assoc Event Number	1	Event #1	<a href="#">more</a>
V1318 — Intrusion 02 Max Intrusion X-axis	02 cm	—	—
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1321 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1322 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1323 — Intrusion 02 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1324 — Intrusion 02 Injury Number	00	No injury or no intrusion	<a href="#">more</a>

V1325 — Intrusion Number 03	00	No Intrusion, None	<a href="#">more</a>
V1326 — Intrusion 03 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1327 — Intrusion 03 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1328 — Intrusion 03 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1329 — Intrusion 03 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1332 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1333 — Intrusion 03 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1334 — Intrusion 03 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1335 — Intrusion 03 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1336 — Intrusion Number 04	00	No Intrusion, None	<a href="#">more</a>
V1337 — Intrusion 04 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1338 — Intrusion 04 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1339 — Intrusion 04 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1340 — Intrusion 04 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1346 — Intrusion 04 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1347 — Intrusion Number 05	00	No Intrusion, None	<a href="#">more</a>
V1348 — Intrusion 05 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1349 — Intrusion 05 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1350 — Intrusion 05 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1351 — Intrusion 05 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>

V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1357 — Intrusion 05 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1358 — Intrusion Number 06	00	No Intrusion, None	<a href="#">more</a>
V1359 — Intrusion 06 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1360 — Intrusion 06 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1361 — Intrusion 06 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1364 — Intrusion 06 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1368 — Intrusion 06 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1369 — Intrusion Number 07	00	No Intrusion, None	<a href="#">more</a>
V1370 — Intrusion 07 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1371 — Intrusion 07 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1372 — Intrusion 07 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1373 — Intrusion 07 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1379 — Intrusion 07 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1380 — Intrusion Number 08	00	No Intrusion, None	<a href="#">more</a>
V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>

V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1391 — Intrusion Number 09	00	No Intrusion, None	<a href="#">more</a>
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	<a href="#">more</a>
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1402 — Intrusion Number 10	00	No Intrusion, None	<a href="#">more</a>
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	<a href="#">more</a>
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	<a href="#">more</a>
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	<a href="#">more</a>
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	<a href="#">more</a>
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	<a href="#">more</a>

V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	<a href="#">more</a>
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	<a href="#">more</a>
V1413 — Door Intrusion Number 01	88	Not Applicable	<a href="#">more</a>
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	<a href="#">more</a>
V1415 — Door Intrusion Number 02	88	Not Applicable	<a href="#">more</a>
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	<a href="#">more</a>
V1417 — Door Intrusion Number 03	88	Not Applicable	<a href="#">more</a>
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	<a href="#">more</a>
V1419 — Door Intrusion 01 Component	88	Not Applicable	<a href="#">more</a>
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1422 — Door Intrusion 02 Component	88	Not Applicable	<a href="#">more</a>
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1425 — Door Intrusion 03 Component	88	Not Applicable	<a href="#">more</a>
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	<a href="#">more</a>
V1428 — Door Intrusion 04 Component	88	Not Applicable	<a href="#">more</a>
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	<a href="#">more</a>
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	<a href="#">more</a>

## Case Vehicle

### Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	<a href="#">more</a>
V1502 — Driver Airbag Deployed	1	Yes	<a href="#">more</a>
V1503 — Driver Airbag Condition	0	No Damage	<a href="#">more</a>
V1504 — Passenger Airbag Equip	1	Yes	<a href="#">more</a>
V1505 — Passenger Airbag Deployed	1	Yes	<a href="#">more</a>
V1506 — Passenger Airbag Condition	0	No Damage	<a href="#">more</a>
V1507 — Steering Wheel Airbag Tether	1	Yes	<a href="#">more</a>
V1508 — Driver Airbag Marked By Contact	1	Yes	<a href="#">more</a>
V1509 — Passenger Airbag Tether	0	No	<a href="#">more</a>
V1510 — Passenger Airbag Marked By Contact	1	Yes	<a href="#">more</a>

## Case Vehicle

### Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	3	No, occupant contact	<a href="#">more</a>
V1602 — Right Front Door Damaged	0	No	<a href="#">more</a>
V1603 — Left Front Hardware Damaged	0	No	<a href="#">more</a>
V1604 — Right Front Hardware Damaged	0	No	<a href="#">more</a>
V1605 — Left Front Armrest Damaged	3	No, occupant contact	<a href="#">more</a>
V1606 — Right Front Armrest Damaged	0	No	<a href="#">more</a>
V1607 — Left Front Glass Damaged	0	No	<a href="#">more</a>
V1608 — Right Front Glass Damaged	0	No	<a href="#">more</a>
V1609 — Left Rear Door Area Damaged	0	No	<a href="#">more</a>
V1610 — Right Rear Door Area Damaged	0	No	<a href="#">more</a>
V1611 — Left Rear Hardware Damaged	0	No	<a href="#">more</a>
V1612 — Right Rear Hardware Damaged	0	No	<a href="#">more</a>
V1613 — Left Rear Armrest Damaged	0	No	<a href="#">more</a>
V1614 — Right Rear Armrest Damaged	0	No	<a href="#">more</a>
V1615 — Left Rear Glass Damaged	0	No	<a href="#">more</a>
V1616 — Right Rear Glass Damaged	0	No	<a href="#">more</a>
V1617 — Left Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1618 — Right Roof Side Rail Damaged	0	No	<a href="#">more</a>
V1619 — Left B-pillar Damaged	0	No	<a href="#">more</a>
V1620 — Right B-pillar Damaged	0	No	<a href="#">more</a>
V1621 — Left C-pillar Damaged	0	No	<a href="#">more</a>
V1622 — Right C-pillar Damaged	0	No	<a href="#">more</a>
V1623 — Left D-pillar Damaged	0	No	<a href="#">more</a>
V1624 — Right D-pillar Damaged	0	No	<a href="#">more</a>
V1625 — Left Headlining Damaged	3	No, occupant contact	<a href="#">more</a>

V1626 — Right Headlining Damaged	0	No	<a href="#">more</a>
V1627 — Left Roof Structure Damaged	0	No	<a href="#">more</a>
V1628 — Right Roof Structure Damaged	0	No	<a href="#">more</a>
V1629 — Left T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1630 — Right T/Sun Roof Damaged	8	Not applicable	<a href="#">more</a>
V1631 — Other Left Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1632 — Other Right Side Item Damagd	8	Not applicable	<a href="#">more</a>
V1633 — Foot Controls Damaged	0	No	<a href="#">more</a>
V1634 — Ignition Key Damaged	0	No	<a href="#">more</a>
V1635 — Rear View Mirror Damaged	0	No	<a href="#">more</a>
V1636 — Sunvisor/Fitting Damaged	7	Both sides	<a href="#">more</a>
V1637 — Windshield Molding Damaged	0	No	<a href="#">more</a>
V1638 — Left A-pillar Damaged	0	No	<a href="#">more</a>
V1639 — Right A-pillar Damaged	3	No, occupant contact	<a href="#">more</a>
V1640 — Center Console Damaged	8	Not applicable	<a href="#">more</a>
V1641 — Transmission Lever Damaged	0	No	<a href="#">more</a>
V1642 — Horn/Spoke Shroud Damagd	4	Yes, occupant contact	<a href="#">more</a>
V1643 — Upper Panel Damaged	4	Yes, occupant contact	<a href="#">more</a>
V1644 — Mid Panel Damaged	0	No	<a href="#">more</a>
V1645 — Lower Panel Damaged	3	No, occupant contact	<a href="#">more</a>
V1646 — Ashtray Damaged	0	No	<a href="#">more</a>
V1647 — Control Knob/Lever Damaged	0	No	<a href="#">more</a>
V1648 — Glove Compartment Area Damaged	3	No, occupant contact	<a href="#">more</a>
V1649 — Instruments Damaged	0	No	<a href="#">more</a>
V1650 — Park Brake Release Damaged	0	No	<a href="#">more</a>
V1651 — Park Brake Pedal Damaged	0	No	<a href="#">more</a>
V1652 — A/C Or Upper Vent Damaged	1	Yes	<a href="#">more</a>
V1653 — Heater Or A/C Duct Damaged	0	No	<a href="#">more</a>
V1654 — Radio Damaged	0	No	<a href="#">more</a>
V1655 — Other Item Damaged	8	Not applicable	<a href="#">more</a>



V1656 — Rear Window Damaged	0	No	<a href="#">more</a>
V1657 — Rear Window Header Damaged	0	No	<a href="#">more</a>
V1658 — Vertical Console Damaged	1	Yes	<a href="#">more</a>
V1659 — Roof Console Damaged	0	No	<a href="#">more</a>

## Case Vehicle

### Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	<a href="#">more</a>
V1702 — Passenger Front Seat Type	05	Bucket	<a href="#">more</a>
V1703 — Driver Seat Mount Type	1	Standard	<a href="#">more</a>
V1704 — Passenger Seat Mount Type	1	Standard	<a href="#">more</a>
V1705 — Driver Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1706 — Passenger Swivel Mechanism Equipped	0	No	<a href="#">more</a>
V1707 — Driver Seat Original Equipment	1	Yes	<a href="#">more</a>
V1708 — Passenger Seat Original Equipment	1	Yes	<a href="#">more</a>
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	<a href="#">more</a>
V1711 — Driver Seat Damage	0	None	<a href="#">more</a>
V1712 — Passenger Seat Damage	0	None	<a href="#">more</a>
V1713 — Center Front Armrest Damaged	0	No	<a href="#">more</a>
V1714 — Driver Seat Rotation	0	None apparent	<a href="#">more</a>
V1715 — Passenger Seat Rotation	0	None apparent	<a href="#">more</a>
V1716 — Driver Seat-back Type	3	Reclining	<a href="#">more</a>
V1717 — Passenger Seat-back Type	3	Reclining	<a href="#">more</a>
V1718 — Driver Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1719 — Passenger Seat-back Lock Type	1	Manual	<a href="#">more</a>
V1720 — Driver Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1721 — Passenger Seat-back Lock Held	1	Yes	<a href="#">more</a>
V1722 — Driver Recliner Mechanism Held	1	Yes	<a href="#">more</a>
V1723 — Passenger Recliner Mechanism Held	1	Yes	<a href="#">more</a>

V1724 — Driver Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1725 — Passenger Head Restraint Type	1	Adjustable	<a href="#">more</a>
V1726 — Driver Head Rest Removed	0	No	<a href="#">more</a>
V1727 — Passenger Head Rest Removed	0	No	<a href="#">more</a>
V1728 — Driver Head Rest Adjustment	2	Down	<a href="#">more</a>
V1729 — Passenger Head Rest Adjustment	2	Down	<a href="#">more</a>
V1730 — Driver Head Rest Damage	0	None	<a href="#">more</a>
V1731 — Passenger Head Rest Damage	0	None	<a href="#">more</a>
V1732 — Driver Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1733 — Passenger Seat Adjustment Type	1	Manual	<a href="#">more</a>
V1734 — Driver Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1735 — Passenger Seat Adjustment Provided	1	2-way	<a href="#">more</a>
V1736 — Driver Seat Adjuster Damage	0	None	<a href="#">more</a>
V1737 — Passenger Seat Adjuster Damage	0	None	<a href="#">more</a>
V1738 — Driver Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	<a href="#">more</a>
V1740 — Driver Seat Pre-crash Position	3	Rearward	<a href="#">more</a>
V1741 — Passenger Seat Pre-crash Position	3	Rearward	<a href="#">more</a>
V1742 — Left Rear Seat Type	2	Folding	<a href="#">more</a>
V1743 — Right Rear Seat Type	2	Folding	<a href="#">more</a>
V1744 — Left Rear Seat Damaged	0	None	<a href="#">more</a>
V1745 — Right Rear Seat Damaged	0	None	<a href="#">more</a>
V1746 — Center Rear Armrest Damaged	0	No	<a href="#">more</a>
V1747 — Left Rear Seat-back Left Lock Equipped	1	Yes	<a href="#">more</a>
V1748 — Right Rear Seat-back Left Lock Equipped	0	No	<a href="#">more</a>
V1749 — Left Rear Seat-back Left Lock Held	1	Yes	<a href="#">more</a>
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	<a href="#">more</a>

V1751 — Left Rear Seat-back Right Lock Equipped	0	No	<a href="#">more</a>
V1752 — Right Rear Seat-back Right Lock Equipped	1	Yes	<a href="#">more</a>
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	<a href="#">more</a>
V1754 — Right Rear Seat-back Right Lock Held	1	Yes	<a href="#">more</a>
V1755 — Left 3rd Seat Equipped	1	Yes	<a href="#">more</a>
V1756 — Right 3rd Seat Equipped	1	Yes	<a href="#">more</a>
V1757 — Left 3rd Seat Backrest Damaged	0	No	<a href="#">more</a>
V1758 — Right 3rd Seat Backrest Damaged	0	No	<a href="#">more</a>
V1759 — Left 3rd Seat Cushion Damaged	0	No	<a href="#">more</a>
V1760 — Right 3rd Seat Cushion Damaged	0	No	<a href="#">more</a>
V1761 — Rear Head Restraints	1	Equipped	<a href="#">more</a>



Max crush to left side  
at forward portion of rear  
wheel end



Width of direct  
damage to  
right side

Width of direct  
damage to  
left side

Max crush  
to right  
side



Max crush  
to right  
side

Max crush  
to right  
side

Max crush  
to right  
side




Max crush  
to right  
side

Max crush  
to right  
side


Max crush  
to right  
side

# REQUIREMENTS IN CENTIMETERS

Front bumper shifted to left

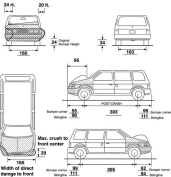

Center Marking



Center Marking Area



Center  10  
 If you need more:   
 at 1 and 11 o'clock.

Bottom  10  
 If you need more:



**Windshield cracked due to contact by right rear edge of hood**



1 = Definitely 2 = Probably 3 = Possible

## INTRUSION IT-1


Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)				Dominant Crush Direction
		Comparison Value	–	Intruded Value	= Intrusion	
13	Toepan	98	–	96	= 2	X
13	Kick panel	62	–	57	= 5	Y
			–		=	
			–		=	
			–		=	
			–		=	
			–		=	
			–		=	
			–		=	
			–		=	

## OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	knee bolster	DR	Lt. knee	plastic crazed	1
B	steering wheel airbag	DR		blood smear	2
C	roof	DR	Head	cloth or hair deposit	2
D	roof	RF	Head	cloth or hair deposit	2
E	passenger airbag	RF	Face	Make up or dirt	1
F	upper instrument panel/vertical console	Dr		scuff mark	1
G	glove box door	RF	Legs	scuff mark	2


C = roof, cloth or  
hair deposits

D = roof, cloth or  
hair deposits



E = Passenger  
air bag, make up or dirt

B = Steering wheel  
air bag, blood  
smear




A = knee bolster,  
cracked

F = upper instrument panel  
and vertical console trim,  
scuff mark

G = glove box door,  
scuff mark

Object sitting



Object sitting down



Radius  $r$  is \_\_\_\_\_  
 if you know \_\_\_\_\_  
 (all 3 and 11 are given)

Radius  $r$  is \_\_\_\_\_  
 if you know \_\_\_\_\_

Passenger Airbag



Passenger Airbag/Door

Single Door



Notes: 1. If you have more than 1

2. and 3. of each one added

Notes: 1. If you have more than 1

# Case # 323: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	CRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 323: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	34	Restraint system webbing	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	CRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 323: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	<a href="#">more</a>
V2102 — 1st Prob Contact Area	56	Lower instrument panel	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	12	Leg (lower)	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	LLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 323: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	<a href="#">more</a>
V2102 — 1st Prob Contact Area	27	Console on floor or between seats	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—



# Case # 323: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	<a href="#">more</a>
V2102 — 1st Prob Contact Area	86	Vertical console	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	11	Knee	<a href="#">more</a>
V2105 — Primary OIC -aspect	12	Left	<a href="#">more</a>
V2106 — Primary OIC -lesion	03	Contusion	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	09	Integumentary	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	KLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

# Case # 323: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	<a href="#">more</a>
V2003 — Occupant Position -row	1	1st row	<a href="#">more</a>
V2004 — Occupant Position -lateral	1	Left	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	69	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	156 kg	—	—
V2009 — Occupant Height	175 cm	—	—
V2010 — Occupant Sex	1	Male	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	02	Treated at hospital/clinic but not admitted	<a href="#">more</a>
V2012 — Injury Severity Score	09	ISS 9	<a href="#">more</a>
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	2	B - Non-incapacitating Injury	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2017 — Passive Restraint System	1	Air bag installed	<a href="#">more</a>
V2018 — Passive Restraint Usage	2	Air bag deployed	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>

V2022 — Highest OIC Severity	2	Moderate	<a href="#">more</a>
V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	0	None	<a href="#">more</a>
V2025 — Source of Occupant Info	7	Combination of above	<a href="#">more</a>

# Case # 323: Occupant # 2; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	<a href="#">more</a>
V2102 — 1st Prob Contact Area	10	Sunvisor, fitting(s) &/or top molding	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	14	A-pillar	<a href="#">more</a>
V2104 — Primary OIC -body Region	14	Neck	<a href="#">more</a>
V2105 — Primary OIC -aspect	16	Posterior/back	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	2	Moderate	<a href="#">more</a>
V2109 — Primary OIC	NPFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 323: Occupant # 2; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	<a href="#">more</a>
V2102 — 1st Prob Contact Area	20	Surface of side interior	<a href="#">more</a>
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	<a href="#">more</a>
V2104 — Primary OIC -body Region	03	Chest	<a href="#">more</a>
V2105 — Primary OIC -aspect	18	Right	<a href="#">more</a>
V2106 — Primary OIC -lesion	06	Fracture	<a href="#">more</a>
V2107 — Primary OIC -system/Organ	19	Skeletal	<a href="#">more</a>
V2108 — Primary OIC -severity	1	Minor	<a href="#">more</a>
V2109 — Primary OIC	CRFS1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	<a href="#">more</a>
V2111 — Assoc OIC 1 -aspect	99	No injury	<a href="#">more</a>
V2112 — Assoc OIC 1 -lesion	99	No injury	<a href="#">more</a>
V2113 — Assoc OIC 1 -system/Organ	99	No injury	<a href="#">more</a>
V2114 — Assoc OIC 1 -severity	9	Unknown	<a href="#">more</a>
V2115 — Assoc OIC 1	—	—	—

## Case # 323: Occupant # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	02	Occupant #2	<a href="#">more</a>
V2002 — Occupant Role At 1st Impact	2	Motor vehicle passenger	<a href="#">more</a>
V2003 — Occupant Position -row	1	1st row	<a href="#">more</a>
V2004 — Occupant Position -lateral	5	Right	<a href="#">more</a>
V2005 — Occupant Position -posture	10	Sitting on seat	<a href="#">more</a>
V2006 — Occupant Age In Years	69	—	—
V2007 — Occupant Age In Months	25	25 months or older	<a href="#">more</a>
V2008 — Occupant Mass	122 kg	—	—
V2009 — Occupant Height	168 cm	—	—
V2010 — Occupant Sex	2	Female	<a href="#">more</a>
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	<a href="#">more</a>
V2012 — Injury Severity Score	05	ISS 5	<a href="#">more</a>
V2013 — Non-impact Med Condition	0	None	<a href="#">more</a>
V2014 — Police Injury Severity	2	B - Non-incapacitating Injury	<a href="#">more</a>
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	<a href="#">more</a>
V2016 — Active Restraint Usage	0	None (available but not used)	<a href="#">more</a>
V2017 — Passive Restraint System	1	Air bag installed	<a href="#">more</a>
V2018 — Passive Restraint Usage	2	Air bag deployed	<a href="#">more</a>
V2019 — Child Seat Type	88	Not applicable (adult or older child)	<a href="#">more</a>
V2020 — Occupant Ejection Degree	0	None	<a href="#">more</a>
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	<a href="#">more</a>
V2022 — Highest OIC Severity	2	Moderate	<a href="#">more</a>

V2023 — Head Restraint Available	1	Equipped	<a href="#">more</a>
V2024 — Occupant Eyewear	9	Unknown	<a href="#">more</a>
V2025 — Source of Occupant Info	1	Hospital	<a href="#">more</a>





























WISCONSIN  
45





















422  
132813  
FBI  
VKY P  
VW  
200480





























BI  
KY P  
u  
200480



























422  
130813  
FBI  
XRY P  
WV  
20480









20488

132813





132013 FBT

PT





422

132813

FBI

444 P

VIN

200480

100



422  
132813  
FBI  
XKY P  
VIN  
200480









P32813 FBC

DODGE

P32813  
PBL





B2813  
PBI 24

GRAND CARAVAN





GRAND CARAVAN

SPORT





422  
132813  
FBI  
VIA P  
VIN 200180

132813  
FBI P









132813  
FBI





































































Specify

Model

Color

Material

Finish

Price

Lead Time

Notes

Remarks

TYPE OF PERSONAL

NAME

DATE

TIME

LOCATION

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR

MAIN FLOOR











**WARNING**  
**NEVER EN DANGER**  
This vehicle is equipped with a Supplemental Restraint System (SRS) air bag. Always use proper seating position and seat belt use. Do not drink and drive. Do not use alcohol or drugs while driving. Do not use the vehicle if you are feeling drowsy or fatigued. Do not use the vehicle if you are under the influence of any medication that may impair your ability to drive. Do not use the vehicle if you are feeling dizzy or lightheaded. Do not use the vehicle if you are feeling nauseous or sick. Do not use the vehicle if you are feeling any other symptoms that may impair your ability to drive. Do not use the vehicle if you are feeling any other symptoms that may impair your ability to drive. Do not use the vehicle if you are feeling any other symptoms that may impair your ability to drive.









































































